

Seller Terms: The inspector or the inspection company shall not be held liable for any incidents or mechanical issues that may arise following the inspection. By signing this agreement, I acknowledge that I waive my right to take any legal action or pursue claims against the inspector or the company regarding the vehicle's condition.

General Information

| | |
|---------------------|--------------|
| Customer Name | Amir |
| Seller Phone Number | +61470613455 |
| Inspection Date | 2026-04-27 |
| Document ID | AS-337669 |

Vehicle Specifications


Vehicle Photo



| | |
|------------------------|-------------------|
| Vehicle Brand | Mini Cooper |
| Model | Countryman |
| Year | 2017 |
| Interior | Leather |
| Engine Cylinder | 4 Cylinder |
| Spare Tyres | Not Available |
| Number Of Keys | 2 |
| VIN Number | WMWYT1105H3D57263 |
| Mileage | 158881KM |
| Regional Specs | GCC |

Engine & Mechanical Checklist


| | |
|---------------------|-------------|
| Battery Type | Lithium-ion |
|---------------------|-------------|

| | |
|-----------------------------------|--|
| Battery Health | 3 Out Of 5 |
| Battery Holder | PASS |
| Engine Upper Cover | PASS |
| Engine Lower Cover | PASS |
| Hood Holder | PASS |
| Fender Liners | PASS |
| Turbo / Supercharger | PASS |
| Engine Idle | PASS |
| Engine Oil Filter Cap | PASS |
| Radiator | PASS |
| Radiator Hoses & Pipes | PASS |
| Coolant Level | PASS |
| Engine Oil Level | Oil is black need to be replace |
| Engine Oil Photo |  |

Engine Oil Leaks

Oil leaking from timing cover and crankcase gasket

Oil Leaking Photo

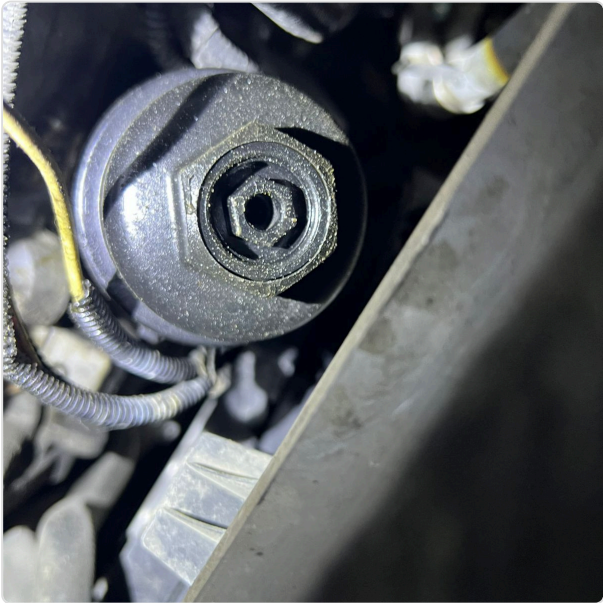






| | |
|---------------------------------|-------------|
| Exhaust System | PASS |
| Visible Rust | PASS |
| Transmission Condition | PASS |
| Transmission Fluid Leaks | PASS |

Test Drive & Performance

| | |
|--------------------------|-------------|
| Drive Shaft | PASS |
| Noise | PASS |
| Gear Shifting | PASS |
| Front Deferential | PASS |
| Rear Deferential | PASS |
| Braks Pads Front | PASS |
| Braks Discs Front | PASS |

| | |
|--------------------------------------|--|
| <p>Braks Pads Rear</p> | <p>Need to be replaced</p> |
| <p>Rear Braks Pads Photo</p> |  |
| <p>Braks Discs Rear</p> | <p>Needs to be make skimming</p> |
| <p>Rear Braks Discs Photo</p> |  |
| <p>ABS Sensor</p> | <p>PASS</p> |
| <p>Hand Brake</p> | <p>PASS</p> |
| <p>Front Suspension</p> | <p>Both sides shock absorber needs to be replaced.</p> |
| <p>Front Suspension Photo</p> | |

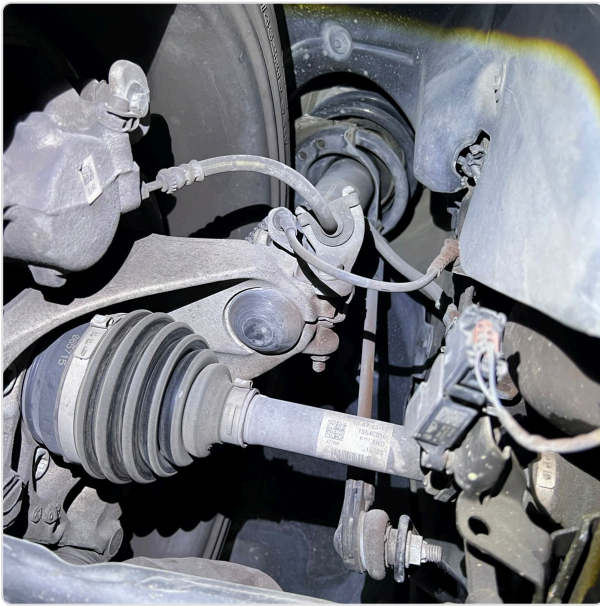

Rear Suspension

Other

Rear Suspension Photo



Wheel Alignment

PASS

Tyres Condition

| Position | Manufacturer | Date | Size | Condition |
|------------------|--------------|------|------------|---------------|
| Front Right Tyre | Nexen | 2022 | 225/45ZR19 | Needs Replace |
| Front Left Tyre | Nexen | 2022 | 225/45ZR19 | Needs Replace |
| Rear Left Tyre | Nexen | 2022 | 225/45ZR19 | Needs Replace |
| Rear Right Tyre | Nexen | 2022 | 225/45ZR19 | Needs Replace |
| Spare Tyre | - | - | - | N/A |

Tyres Details

Front Right Tyre Photo




Front Left Tyre Photo



Rear Right Tyre Photo



Rear Left Tyre Photo

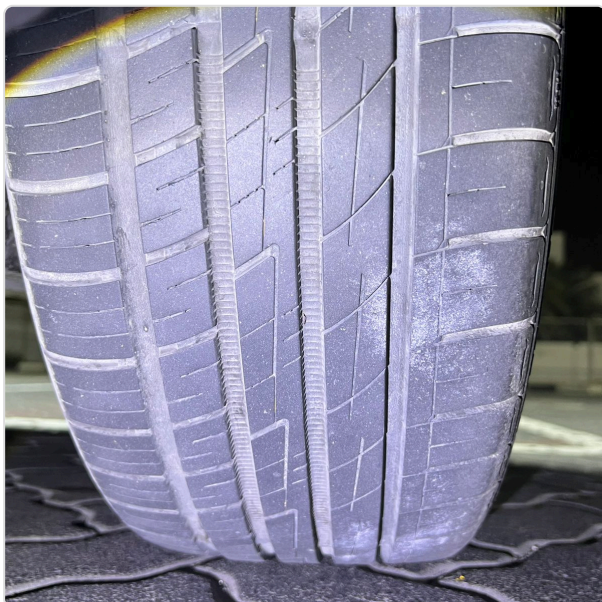



Interior Details

| | |
|-----------------------------|-----------------|
| Entertainment System | PASS |
| A/C cooling and controlling | PASS |
| A/C grilles | PASS |
| Windows Operation | PASS |
| Seats Adjustment | PASS |
| Door lock / Unlock | PASS |
| Center Console Buttons | PASS |
| Cameras | PASS |
| Gauges | PASS |
| Rear View Side Mirror | PASS |
| Rear View Mirror | PASS |
| Steering Wheel Upholstery | PASS |
| Roof Lining | PASS |
| Seats Upholstery | PASS |
| Seat Belt | PASS |
| Gear Lever | Minor scratches |
| Gear Lever Photo | |



Trunk Lining

PASS

Armrest & Side Pockets

PASS

Dashboard

PASS

Floor Mats

PASS

Wipers

Front wipers bleed needs to be replaced

Wipers Photo



Front Windscreen

PASS

Rear View Mirror

PASS



Lights Details

| | |
|----------------------|------|
| Headlights | PASS |
| High Beams | PASS |
| Fog Light | PASS |
| Brake Light | PASS |
| Reverse Light | PASS |
| Indicators & Hazards | PASS |
| Indicators & Hazards | PASS |
| Number Plate Light | PASS |
| Chassis Condition | PASS |





Test Drive Performance

| | |
|---|------|
| Does speedometer work? | PASS |
| Is engine sounds normal? | PASS |
| Does transmission gear change smoothly? | PASS |
| Is brakes feel solid and pedal firm? | PASS |
| Does car stop in a straight line? | PASS |
| Does steering pull or vibrate? | PASS |

| | |
|--|----------------------------------|
| Is suspension smooth (no abnormal noises)? | Noise because of shock absorber. |
| Does emergency brake hold properly? | PASS |
| Parking sensors | PASS |

Exterior Details
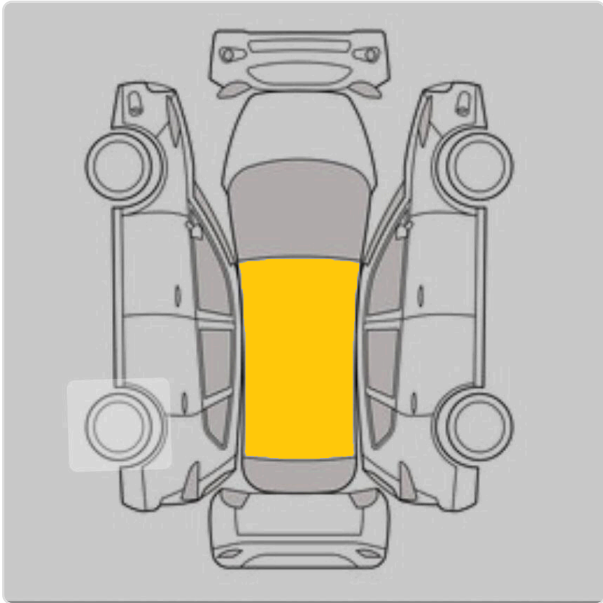
| | |
|------------------------|--|
| Paint conditions Photo |  |
| Exterior Photo |  |






Interior Photo











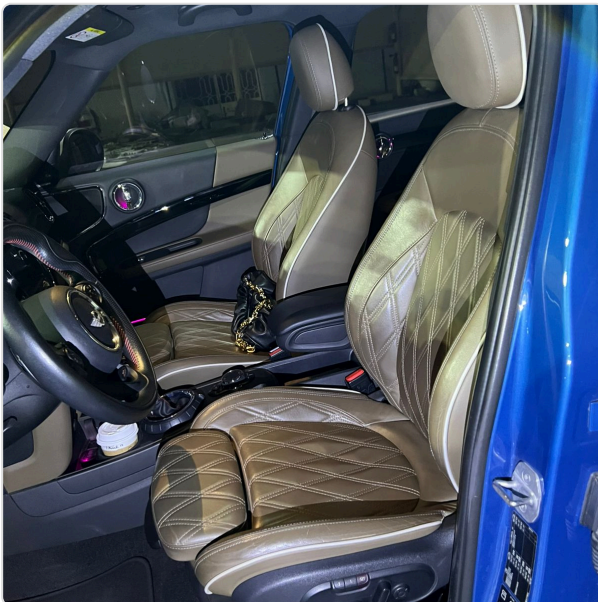



Engine Bay & undercarriage
Photo

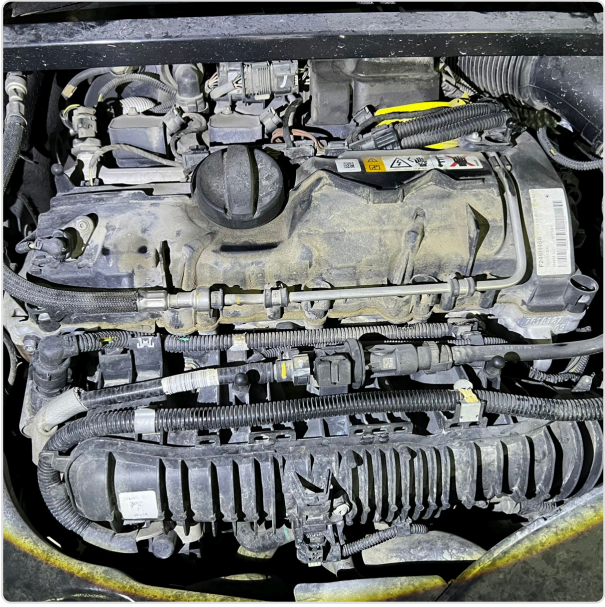


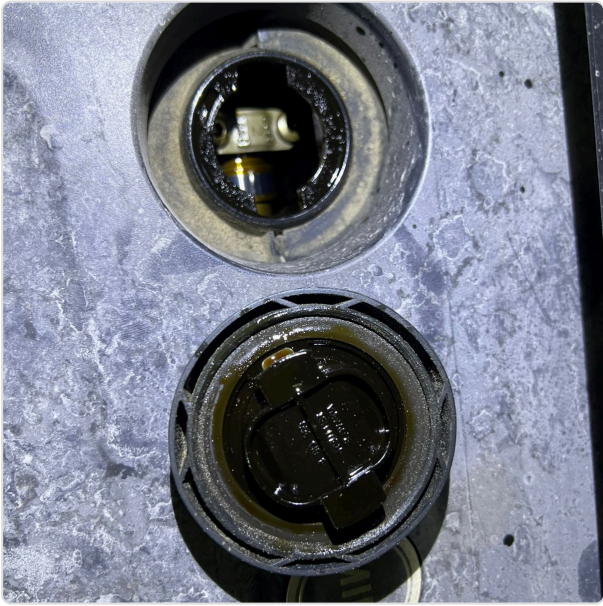

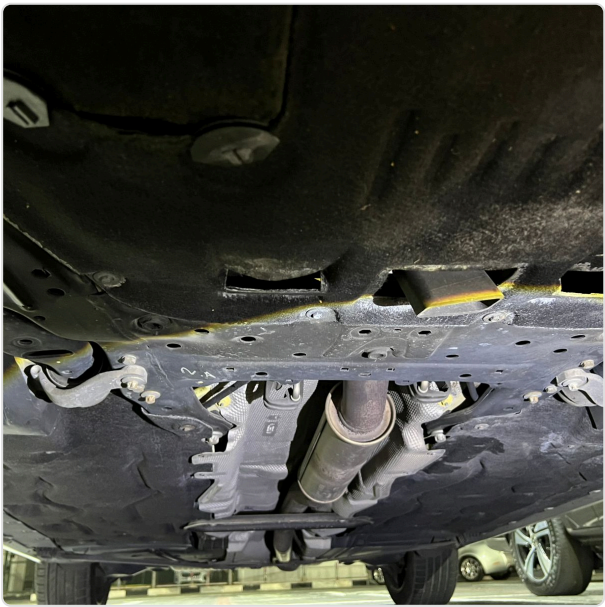

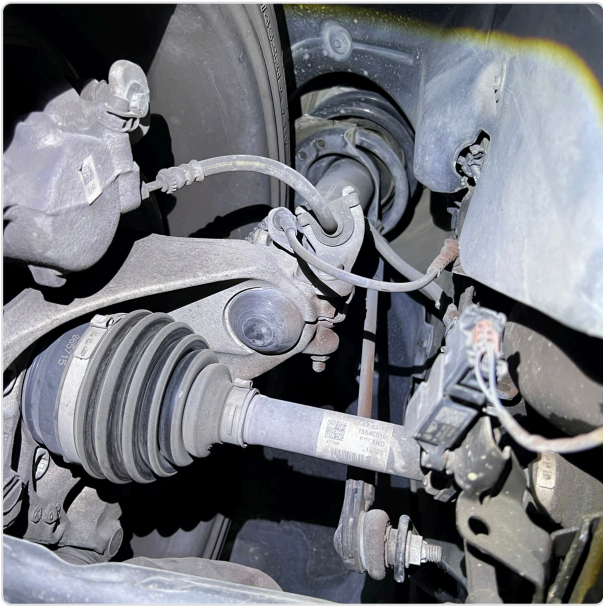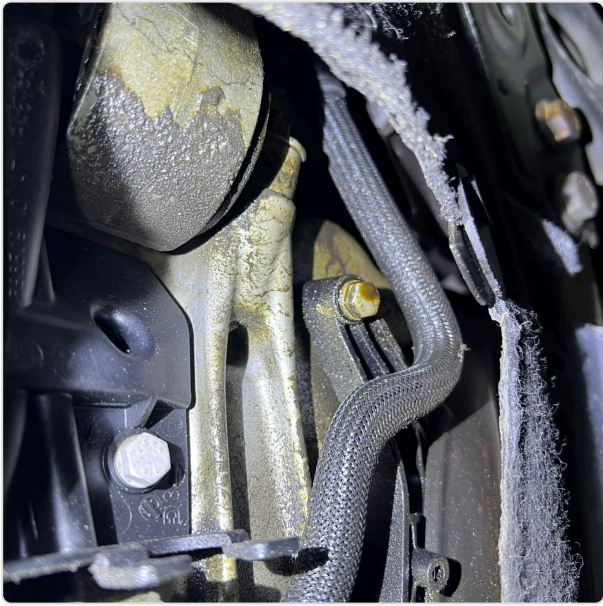

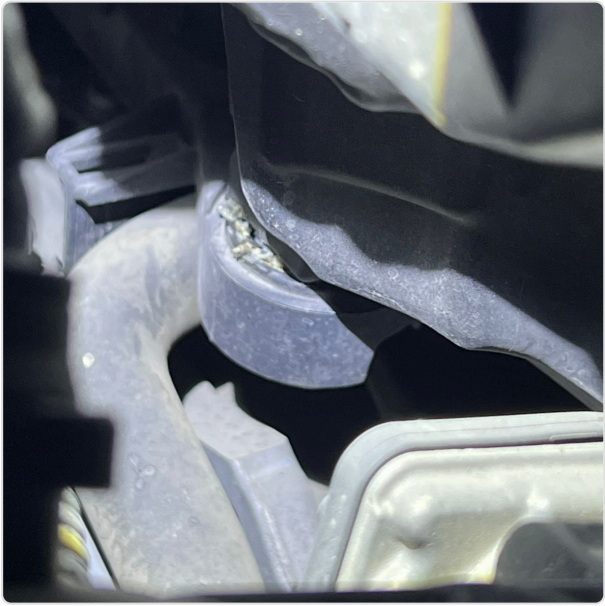

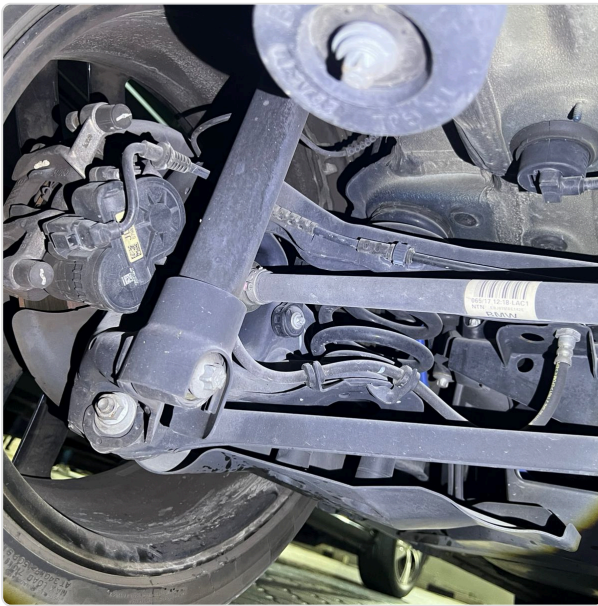

Vehicle summary

Engine oil leaking from timing cover and crankcase gasket. All the shock absorber needs to be replaced. All the tyre needs to be replaced. Rear brake pads needs to be replaced. Minor scratches on body.



Inspector Details

Inspected By

Abdullah Al Mamun-ID-AS10001

Inspector Designation

Tecnichian



Vehicle Phtos Gallery