

Seller Terms: The inspector or the inspection company shall not be held liable for any incidents or mechanical issues that may arise following the inspection. By signing this agreement, I acknowledge that I waive my right to take any legal action or pursue claims against the inspector or the company regarding the vehicle's condition.

General Information

Customer Name	Mohamad
Seller Phone Number	0556000623
Inspection Date	2026-05-09
Document ID	AS-482586

Vehicle Specifications



Vehicle Photo



Vehicle Brand	Dodge
Model	Charger
Year	2021
Interior	Leather
Engine Cylinder	6 Cylinder
Spare Tyres	Not Available
Number Of Keys	1
VIN Number	2C3CDXBGXMH510818
Mileage	71344KM
Regional Specs	USA

Engine & Mechanical Checklist

Battery Health	2 Out Of 5
-----------------------	------------

Battery Holder	PASS
Engine Upper Cover	PASS
Engine Lower Cover	Missing
Engine Lower Photo	
Hood Holder	PASS
Fender Liners	Clip Missing
Fender Liners Photo	



Turbo / Supercharger

N/A

Engine Idle

PASS

Engine Oil Filter Cap

PASS

Radiator

PASS

Radiator Hoses & Pipes

PASS

Coolant Level

PASS

Engine Oil Level

Oil is black need to be replace

Engine Oil Photo




Engine Oil Leaks	PASS
Exhaust System	PASS
Visible Rust	PASS
Transmission Condition	PASS
Transmission Fluid Leaks	PASS
Chassis Condition	PASS



Braks & Suspensions

Drive Shaft	PASS
Noise	PASS
Gear Shifting	PASS
Front Deferential	N/A
Rear Deferential	PASS
Braks Pads Front	Need to be replaced
Front Braks Pads Photo	

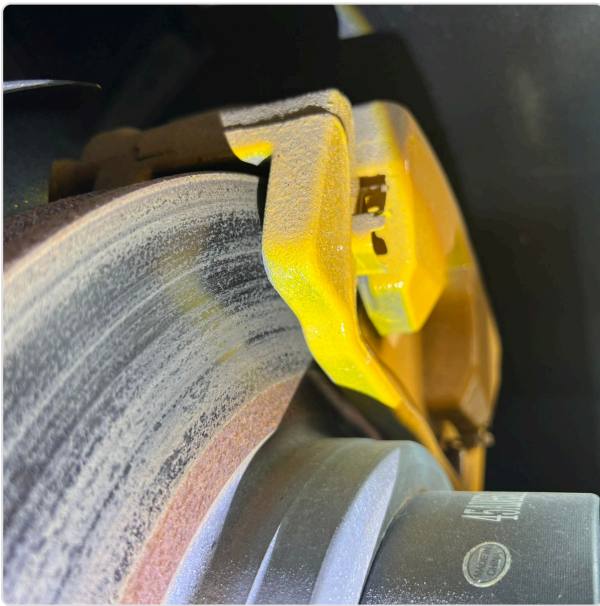

Braks Discs Front

Needs to be make skimming

Front Braks Discs Photo



Braks Pads Rear

Need to be replaced

Rear Braks Pads Photo



Braks Discs Rear

Needs to be make skimming

Rear Braks Discs Photo



ABS Sensor

PASS

Hand Brake

Need to repair

Front Suspension

Both sides lower arm needs to be replaced


Front Suspension Photo



Rear Suspension

Both sides link rod needs to be replaced

Rear Suspension Photo

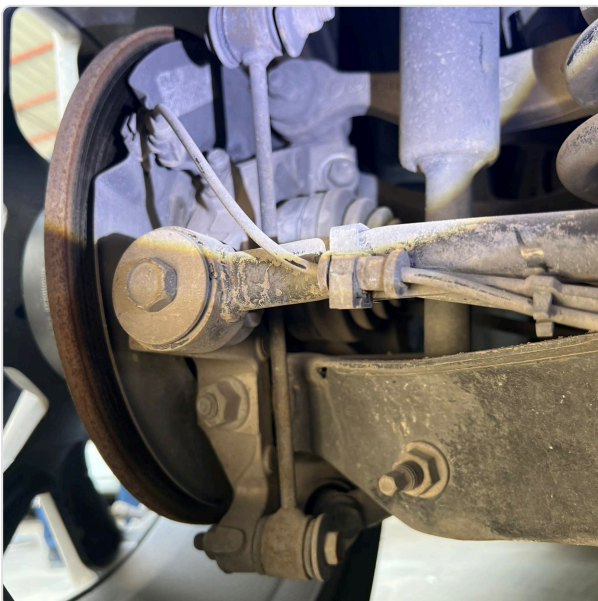



Wheel Alignment

Need to be make alignment

Tyres Details

Position	Manufacturer	Date	Size	Condition
Front Right Tyre	Sailun	2024	255/45R20	Good
Front Left Tyre	Sailun	2024	255/45R20	Good
Rear Left Tyre	Sailun	2024	255/45R20	Good
Rear Right Tyre	Sailun	2024	255/45R20	Good
Spare Tyre	-	-	-	N/A

Tyres Condition

Front Right Tyre Photo



Front Left Tyre Photo




Rear Right Tyre Photo



Rear Left Tyre Photo



Spare Tyre Photo

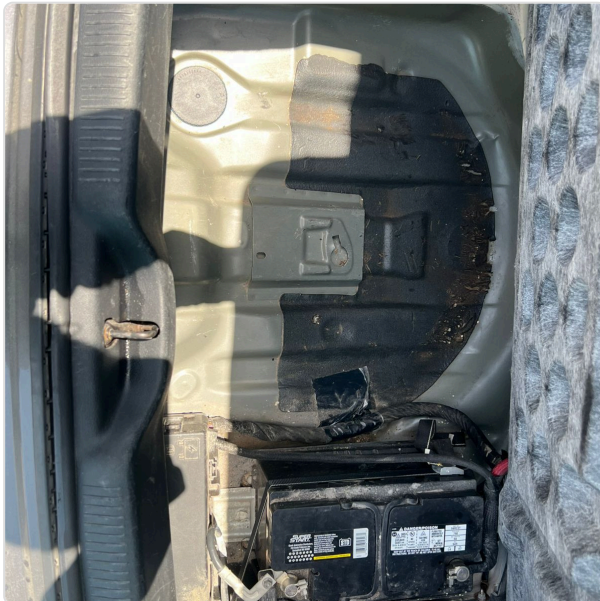

 **Interior Details**

Entertainment System

PASS

A/C cooling and controlling

PASS

A/C grilles

Left side damagd or scratches

A/C grilles Photo



Windows Operation

Front right side not working. Needs to be replaced the driver door switch.

Windows Photo



Seats Adjustment

PASS

Door lock / Unlock

PASS

Center Console Buttons

Minor scratches

Center Console Buttons Photo



Cameras

Needs to be make alignment.

Cameras Photo



Gauges

Airbags and trucktion light on

Gauges Photo



Rear View Side Mirror

PASS

Rear View Mirror

Minor scratches

Rear View Mirror Photo



Steering Wheel Upholstery

PASS

Roof Lining

PASS

Seats Upholstery

PASS

Seat Belt

Right side seatbelt needs to be replaced.

Gear Lever

PASS

Trunk Lining



PASS

Armrest & Side Pockets

Minor scratches

Armrest & Side Pockets Photo



Dashboard	Gloves box damaged. Needs to be replaced.
Dashboard Photo	
Floor Mats	PASS
Wipers	Water motor needs to be replaced.
Wipers Photo	
Front Windscreen	PASS
Rear Windshield	PASS
Rear Windshield Photo	



Lights Details


Headlights	PASS
High Beams	PASS
Fog Light	N/A
Brake Light	PASS
Reverse Light	PASS
Indicators & Hazards	PASS
Number Plate Light	Not working
Number Plate Light Photo	



Test Drive Performance

Does speedometer work?	PASS
Is engine sounds normal?	PASS
Does transmission gear change smoothly?	PASS
Is brakes feel solid and pedal firm?	PASS
Does car stop in a straight line?	FAIL
Does steering pull or vibrate?	PASS
Is suspension smooth (no abnormal noises)?	Rear suspension has minor noise.
Does emergency brake hold properly?	PASS
Parking sensors	PASS

Paint conditions Photo

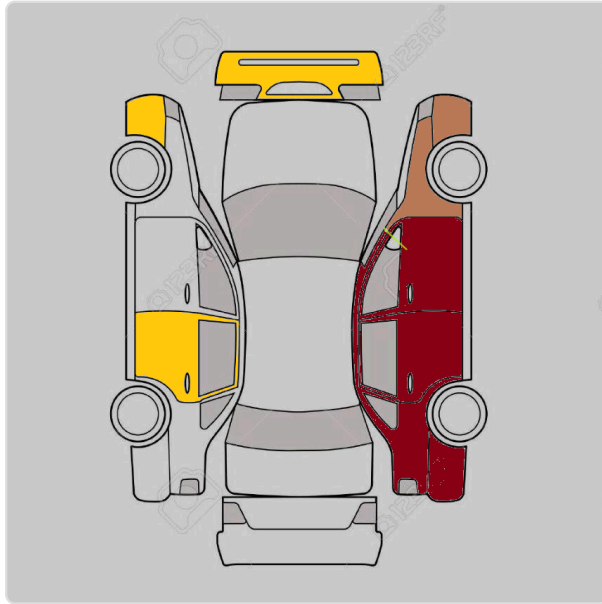

Exterior Photo










Interior Photo

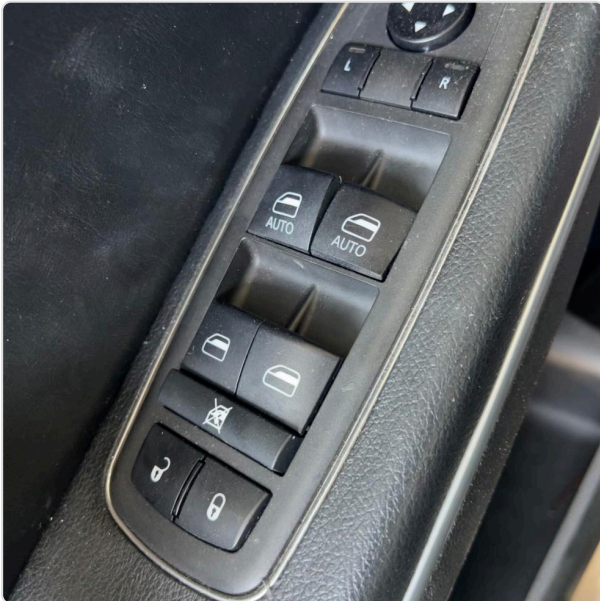







**Engine Bay & undercarriage
Photo**







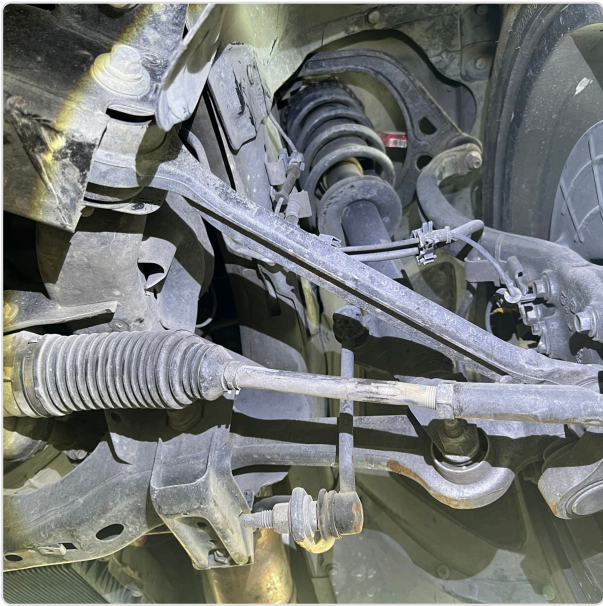

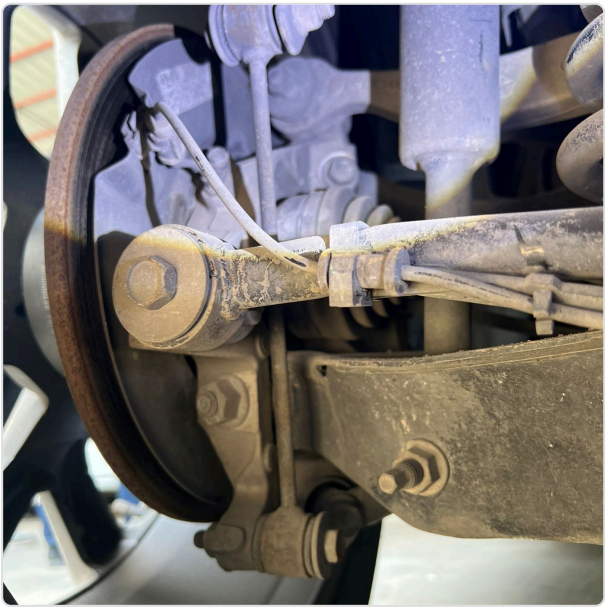



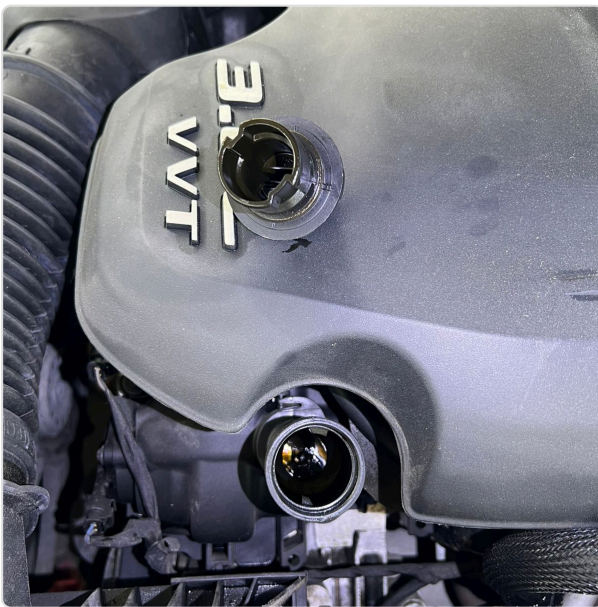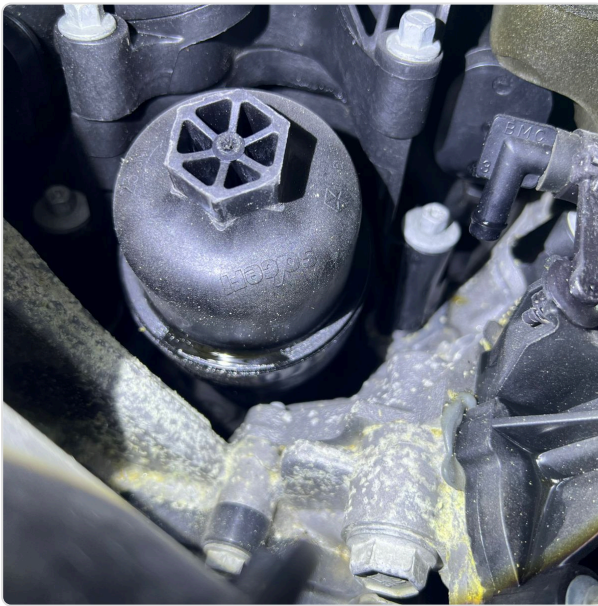

Inspection Summery

Rear bumper needs be fixed properly. Front right side and rear left side tyre not in original position.

Must be needs to be make alignment.oil filter has leaking.

Inspector Details

Inspected By	Abdullah Al Mamun-ID-AS10001
Inspector Designation	Tecnichian

Vehicle Phtos Gallery